



Future Technology Devices International Ltd.

TN_136 FT201X Errata Technical Note

Document Reference No.: FT_000638

Version 1.4

Issue Date: 2013-06-10

The intention of this errata technical note is to give a detailed description of known functional or electrical issues with the FTDI FT201X devices.

The current revision of the FT201X is **revision D, released November 2012.**

Future Technology Devices International Limited (FTDI)

Unit1, 2 Seaward Place, Centurion Business Park, Glasgow G41 1HH United Kingdom

Tel.: +44 (0) 141 429 2777 Fax: + 44 (0) 141 429 2758

E-Mail (Support): support1@ftdichip.com Web: <http://www.ftdichip.com>

Copyright © 2013 Future Technology Devices International Limited

TABLE OF CONTENTS

1	FT201X Revision	2
2	Errata History Table – Functional Problems	3
2.1	Errata History Table – Electrical and Timing Specification Deviations.	3
3	Functional Problems of FT201X	4
3.1	Revision A	4
3.1.1	USB Data Transfer	4
3.1.2	USB 3.0 Hosts	5
3.2	Revision B	6
3.2.1	USB Data Transfer	6
3.2.2	USB 3.0 Hosts	7
3.3	Revision C	8
3.3.1	USB Data Transfer	8
3.3.2	USB 3.0 Hosts	9
3.4	Revision D	9
4	Electrical and Timing specification deviations of FT201X	10
4.1	Revision A	10
4.2	Revision B	10
4.2.1	Internal 3V3 Regulator.....	10
4.3	Revision C	10
4.4	Revision D	10
5	FT201X Package Markings	11
6	Contact Information	12
	Appendix C – Revision History	13

1 FT201X Revision

FT201X part numbers are listed in **Table 1**. The letter at the end of date code identifies the device revision.

The current revision of the FT201X is **revision D, released November 2012**. At the time of releasing this Technical Note there are no known issues with this silicon revision.

Part Number	Package
FT201XQ	16 pin QFN
FT201XS	16 pin SSOP

Table 1 FT201X Part Numbers

This errata technical note covers the revisions of FT201X listed in **Table 2**.

Revision	Notes
A	First device revision. Never sold publicly.
B	Second device revision. Launched 28 February 2012
C	Third device version. Released 11 th June 2012
D	Forth device version. Released 6th November 2012

Table 2 FT201X Revisions

2 Errata History Table – Functional Problems

Functional Problem	Short description	Errata occurs in device revision
USB Data Transfer	Transfer of data over USB stops unexpectedly	A, B and C
USB 3.0 Hosts	USB 3.0 Host occasional interoperability	A, B and C

Table 3 Functional Errata

2.1 Errata History Table – Electrical and Timing Specification Deviations.

Deviations	Short description	Errata occurs in device revision
Fault with internal 3V3 regulator.	Device VCC is designed to operate between 3V3 and 5V however with this errata the supply should not be set below 4.3V for correct operation.	B

Table 4 Electrical and Timing Errata

3 Functional Problems of FT201X

3.1 Revision A

3.1.1 USB Data Transfer

Introduction:

An issue has been identified where the transfer of data over USB stops unexpectedly.

Problem:

The device is put into suspend mode during a transfer of certain data patterns most notable with binary zeros. This can halt the data transfer in certain circumstances and will require the device to be re-enumerated to recover.

NB. It is the presence of this data pattern on the USB bus regardless of whether the data is intended for the FT201X or other devices (e.g. a broadcast) on the bus that forces the suspend state.

Workaround:

This issue can be avoided by utilising the keep awake function of the chip. This will disable the USB suspend function of the chip and is therefore an intermediate workaround until revision D silicon is released with a permanent fix.

NB. With the workaround the chip will never enter lower powered suspend. However the keep awake current will be approximately 3mA.

To enable the keep awake function in the EEPROM, one of the CBUS pins needs to be configured as Keep-Awake#. This pin then needs to be tied to ground on the PCB. The [FT_Prog](#) utility can be used to configure the CBUS pin.

Package specific:

The effected packages are listed in Table 5.

Package	Applicable (Yes/No)
FT201XQ	Y
FT201XS	Y

Table 5

3.1.2 USB 3.0 Hosts

Introduction:

An issue has been identified where the FT201X will not enumerate when connected to certain USB 3.0 Hosts. So far FTDI have identified **ONE** such host.

Problem:

Certain USB 3.0 Hosts exhibit reduced reset recovery times after a USB reset, which can at times be faster or close to the USB 2.0 specification limit. The USB 2.0 specification states a USB reset recovery time of 10ms and in general almost all hosts allocate a much longer period than this. The FT201X device may not enumerate if the reset recovery time is reduced.

This issue has been seen on one USB 3.0 Host controller and has not been seen on a USB 2.0 Host controller or other USB 3.0 Host controllers.

Workaround:

Reconnect the device to a USB 2.0 host. This issue has been seen only on one particular USB 3.0 Host controllers.

Package specific:

The effected packages are listed in Table 6.

Package	Applicable (Yes/No)
FT201XQ	Y
FT201XS	Y

Table 6

3.2 Revision B

3.2.1 USB Data Transfer

Introduction:

An issue has been identified where the transfer of data over USB stops unexpectedly.

Problem:

The device is put into suspend mode during a transfer of certain data patterns most notable with binary zeros. This can halt the data transfer in certain circumstances and will require the device to be re-enumerated to recover.

NB. It is the presence of this data pattern on the USB bus regardless of whether the data is intended for the FT201X or other devices (e.g. a broadcast) on the bus that forces the suspend state.

Workaround:

This issue can be avoided by utilising the keep awake function of the chip. This will disable the USB suspend function of the chip and is therefore an intermediate workaround until revision D silicon is released with a permanent fix.

NB. With the workaround the chip will never enter lower powered suspend. However the keep awake current will be approximately 3mA.

To enable the keep awake function in the EEPROM, one of the CBUS pins needs to be configured as Keep-Awake#. This pin then needs to be tied to ground on the PCB. The [FT_Prog](#) utility can be used to configure the CBUS pin.

Package specific:

The effected packages are listed in Table 7.

Package	Applicable (Yes/No)
FT201XQ	Y
FT201XS	Y

Table 7

3.2.2 USB 3.0 Hosts

Introduction:

An issue has been identified where the FT201X will not enumerate when connected to certain USB 3.0 Hosts. So far FTDI have identified **ONE** such host.

Problem:

Certain USB 3.0 Hosts exhibit reduced reset recovery times after a USB reset, which can at times be faster or close to the USB 2.0 specification limit. The USB 2.0 specification states a USB reset recovery time of 10ms and in general almost all hosts allocate a much longer period than this. The FT201X device may not enumerate if the reset recovery time is reduced.

This issue has been seen on one USB 3.0 Host controller and has not been seen on a USB 2.0 Host controller or other USB 3.0 Host controllers.

Workaround:

Reconnect the device to a USB 2.0 host. This issue has been seen only on one particular USB 3.0 Host controllers.

Package specific:

The effected packages are listed in Table 8.

Package	Applicable (Yes/No)
FT201XQ	Y
FT201XS	Y

Table 8

3.3 Revision C

3.3.1 USB Data Transfer

Introduction:

An issue has been identified where the transfer of data over USB stops unexpectedly.

Problem:

The device is put into suspend mode during a transfer of certain data patterns most notable with binary zeros. This can halt the data transfer in certain circumstances and will require the device to be re-enumerated to recover.

NB. It is the presence of this data pattern on the USB bus regardless of whether the data is intended for the FT201X or other devices (e.g. a broadcast) on the bus that forces the suspend state.

Workaround:

This issue can be avoided by utilising the keep awake function of the chip. This will disable the USB suspend function of the chip and is therefore an intermediate workaround until revision D silicon is released with a permanent fix.

NB. With the workaround the chip will never enter lower powered suspend. However the keep awake current will be approximately 3mA.

To enable the keep awake function in the EEPROM, one of the CBUS pins needs to be configured as Keep-Awake#. This pin then needs to be tied to ground on the PCB. The [FT_Prog](#) utility can be used to configure the CBUS pin.

Package specific:

The effected packages are listed in Table 9.

Package	Applicable (Yes/No)
FT201XQ	Y
FT201XS	Y

Table 9

3.3.2 USB 3.0 Hosts

Introduction:

An issue has been identified where the FT201X will not enumerate when connected to certain USB 3.0 Hosts. So far FTDI have identified **ONE** such host.

Problem:

Certain USB 3.0 Hosts exhibit reduced reset recovery times after a USB reset, which can at times be faster or close to the USB 2.0 specification limit. The USB 2.0 specification states a USB reset recovery time of 10ms and in general almost all hosts allocate a much longer period than this. The FT201X device may not enumerate if the reset recovery time is reduced.

This issue has been seen on one USB 3.0 Host controller and has not been seen on a USB 2.0 Host controller or other USB 3.0 Host controllers.

Workaround:

Reconnect the device to a USB 2.0 host. This issue has been seen only on one particular USB 3.0 Host controllers.

Package specific:

The effected packages are listed in Table 10.

Package	Applicable (Yes/No)
FT201XQ	Y
FT201XS	Y

Table 10

3.4 Revision D

No known issues at revision D.

4 Electrical and Timing specification deviations of FT201X

4.1 Revision A

No known issues at revision A

4.2 Revision B

4.2.1 Internal 3V3 Regulator

Introduction:

The FT201X uses an internal regulator to generate 3V3 from a 5V source (VCC). The source should be variable from 3V3 to 5V.

Problem:

The VCC supply to the regulator must not drop below 4.3V for the correct 3V3 regulated output to be produced.

Workaround:

VCC must not be supplied below 4.3V. This issue will be corrected at silicon revision C.

Package specific:

The effected packages are listed in Table 11.

Package	Applicable (Yes/No)
FT201XQ	Y
FT201XS	Y

Table 11

4.3 Revision C

No known issues at revision C

4.4 Revision D

No known issues at revision D.

5 FT201X Package Markings

FT201X is available in a RoHS Compliant package, 16 pin QFN and 16 pin SSOP. An example of the markings on the package is shown in Figure 5.1.

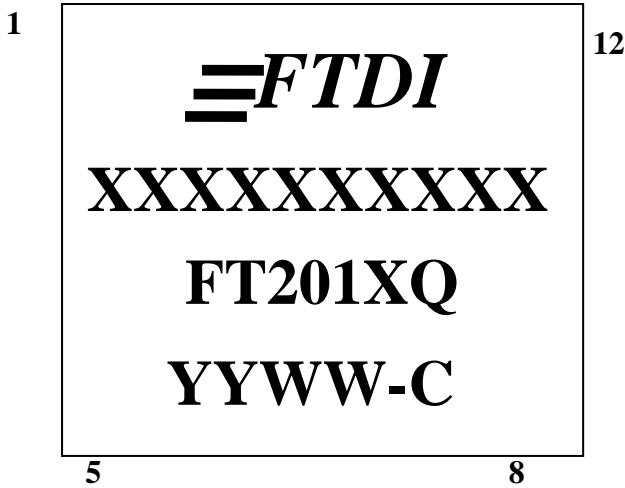


Figure 5-1 Package Markings – FT201XQ

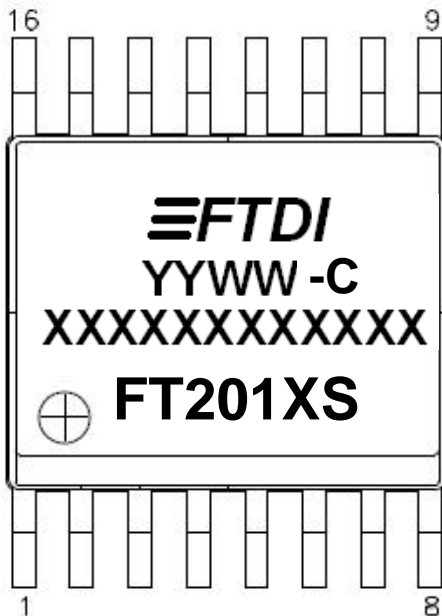


Figure 5-2 Package Markings – FT201XS

The date code format is **YYWW** where WW = 2 digit week number, YY = 2 digit year number. This is followed by the revision number.

The code **XXXXXXXXXXXX** is the manufacturing LOT code

6 Contact Information

Head Office – Glasgow, UK

Unit 1, 2 Seaward Place, Centurion Business Park
Glasgow G41 1HH
United Kingdom
Tel: +44 (0) 141 429 2777
Fax: +44 (0) 141 429 2758

E-mail (Sales) sales1@ftdichip.com
E-mail (Support) support1@ftdichip.com
E-mail (General Enquiries) admin1@ftdichip.com

Branch Office – Oregon, USA

7130 Fir Loop,
Tigard, OR 97223-8160
USA
Tel: +1 (503) 547 0988
Fax: +1 (503) 547 0987

E-Mail (Sales) us.sales@ftdichip.com
E-Mail (Support) us.support@ftdichip.com
E-Mail (General Enquiries) us.admin@ftdichip.com

Branch Office – Taipei, Taiwan

2F, No. 516, Sec. 1, NeiHu Road
Taipei 114
Taiwan, R.O.C.
Tel: +886 (0) 2 8797 1330
Fax: +886 (0) 2 8751 9737

E-mail (Sales) tw.sales1@ftdichip.com
E-mail (Support) tw.support1@ftdichip.com
E-mail (General Enquiries) tw.admin1@ftdichip.com

Branch Office – Shanghai, China

Room 1103, No. 666 West Huaihai Road,
Shanghai, 200052
China
Tel: +86 21 62351596
Fax: +86 21 62351595

E-mail (Sales) cn.sales@ftdichip.com
E-mail (Support) cn.support@ftdichip.com
E-mail (General Enquiries) cn.admin@ftdichip.com

Web Site

<http://ftdichip.com>

System and equipment manufacturers and designers are responsible to ensure that their systems, and any Future Technology Devices International Ltd (FTDI) devices incorporated in their systems, meet all applicable safety, regulatory and system-level performance requirements. All application-related information in this document (including application descriptions, suggested FTDI devices and other materials) is provided for reference only. While FTDI has taken care to assure it is accurate, this information is subject to customer confirmation, and FTDI disclaims all liability for system designs and for any applications assistance provided by FTDI. Use of FTDI devices in life support and/or safety applications is entirely at the user's risk, and the user agrees to defend, indemnify and hold harmless FTDI from any and all damages, claims, suits or expense resulting from such use. This document is subject to change without notice. No freedom to use patents or other intellectual property rights is implied by the publication of this document. Neither the whole nor any part of the information contained in, or the product described in this document, may be adapted or reproduced in any material or electronic form without the prior written consent of the copyright holder. Future Technology Devices International Ltd, Unit 1, 2 Seaward Place, Centurion Business Park, Glasgow G41 1HH, United Kingdom. Scotland Registered Company Number: SC136640

Appendix C – Revision History

Document Title: TN_136 FT201X Errata Technical Note
Document Reference No.: FT_000638
Clearance No.: FTDI# 282
Product Page: <http://www.ftdichip.com/FT-X.htm>
Document Feedback: [Send Feedback](#)

Version 1.0	First Release	09/03/2012
Version 1.1	Added rev C and Updated China address	11/06/2012
Version 1.2	Added USB data transfer issue	12/07/2012
Version 1.3	Added USB 3.0 hosts and note to Problem section of USB data transfer	14/08/2012
Version 1.4	Added revision D – no known issues updated contact information	10/06/2013